Technical Information Bulletin

SUBJECT: GR Bracket K / Magnet Catch **Document No.: 20025**

[ ] Factory Modification [ ] Field Modification [ ] Safety Information [X] Technical Information [ ] General Information [ ] Adv. Tech Information	Applies to: GR Series	Modification Schedule: [ ] TBS [ ] Next Call [ ] Next PM [X] As Necessary	Factory Installed_____ Field Installed_____ FittingTime _____

Summary: Users may be prevented from raising the GR Paper Receiving Tray to its upright/ locked position when a Key/Card Counter is installed because the tray contacts the body of the Counter before it can reach its magnetic catch. A new, longer type of Bracket; Magnet Catch is now available to solve this problem.

Procedure: Replace old bracket with new, longer version. The new bracket extends out far enough that the tray is able to connect with its magnetic catch and lock in the upright position.

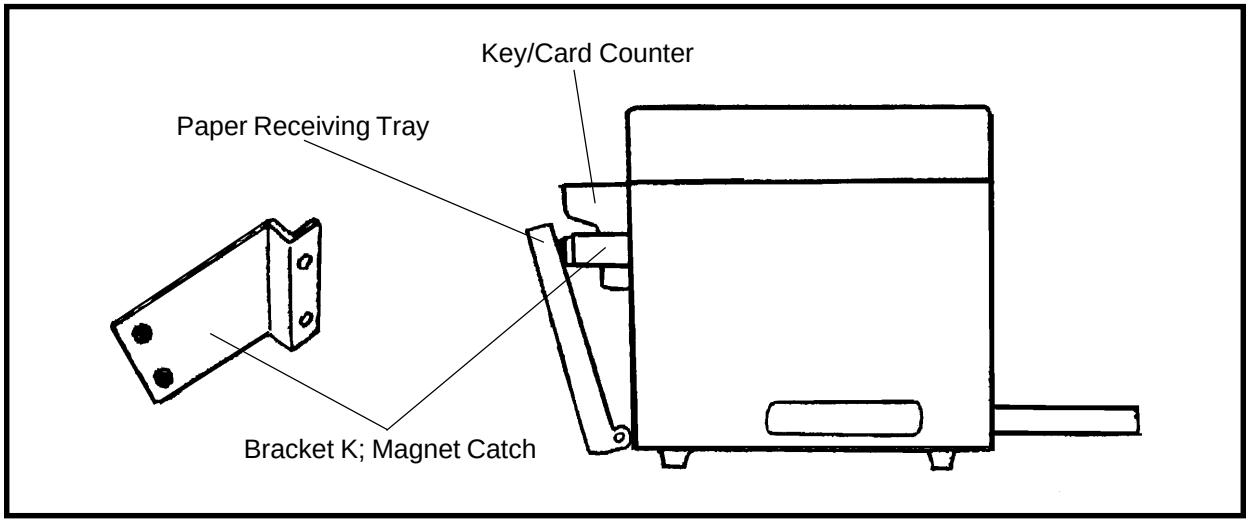

Part # Information:

Old Bracket:	011-13122-109	Bracket; Magnet Catch; P.-Rcv.-T.
New Bracket:	017-13288-000	Bracket K; Magnet Catch; P.-Rcv.-T.